

Waschautomat

UTS-Nr.: 074 FAGOR ELECTODOMESTICOS, S.COOP
Best.Nr.: 3262987/00
FremdNr.: FE-1358
Ger.Bez.: WASCHAUTOMAT

GKz: F FREMDGERAET
WGT: 370 WASCHVOLLAUTOMATEN-FRONTLADER
Ditec Produktgruppe: W WASCHEN
Klassierung: WA
Type/Privileg/Universum.Nr 905110819
Herstellertyp FE-1358
Beschreibung ELEGANCE
VK-Preis: 111.11

Serviceart: 01 PROPECTIS
Garantie fuer Kunden 24 Monate
Sondervereinbarungen: 0 SIEHE SERVICEART




Garantiereparatur 0004063 Profectis GmbH
Sondervereinbarungen: 0 SIEHE SERVICEART


Katalog	Seite
Erst 044 HAUPTKATALOG H/W 2004	0000
Letzt 000 NOCH IM AKTUELLEN KATALOG	0000


Geraete Info:
SERVICE-MANUAL: 001145A1EN


Technische Daten:


Fehler:

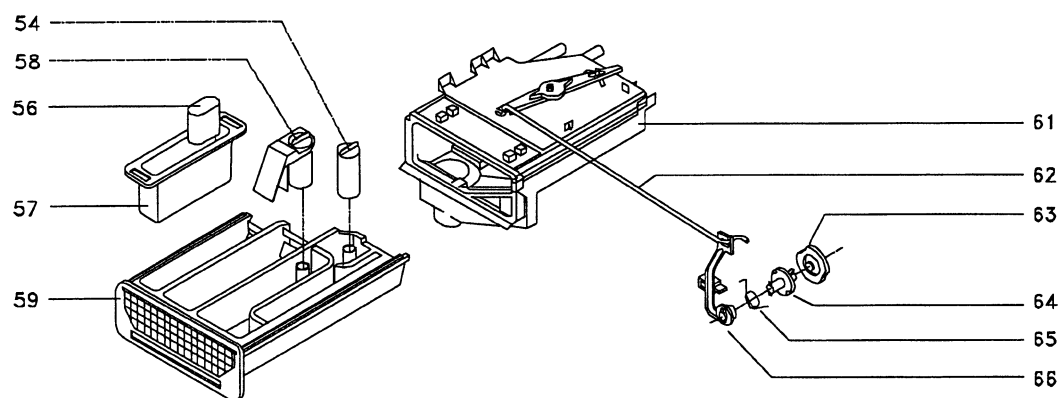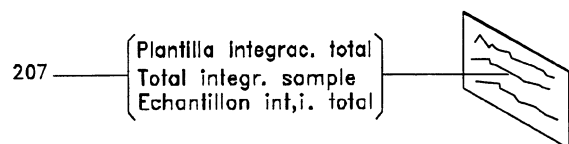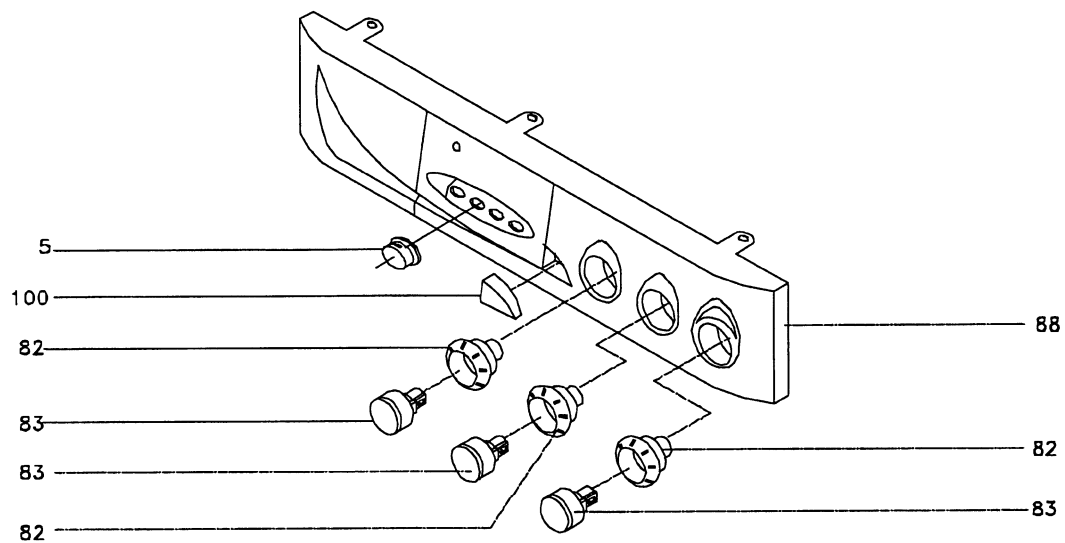

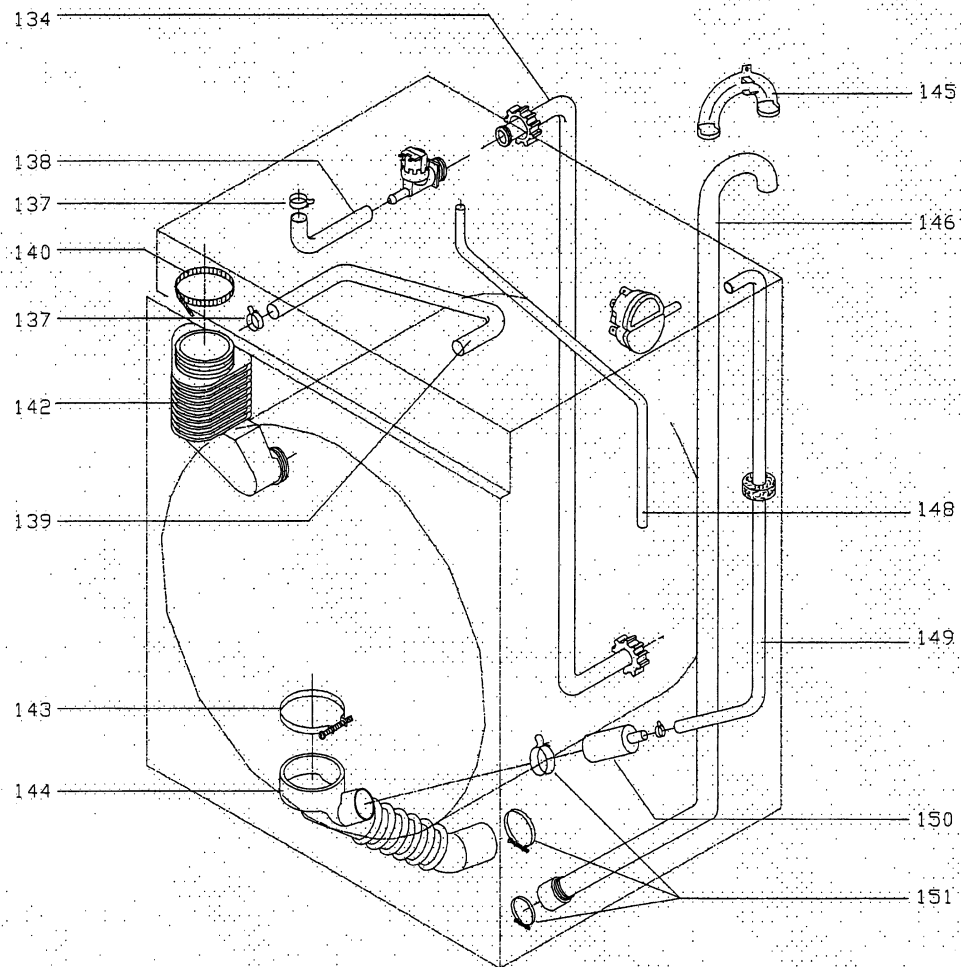


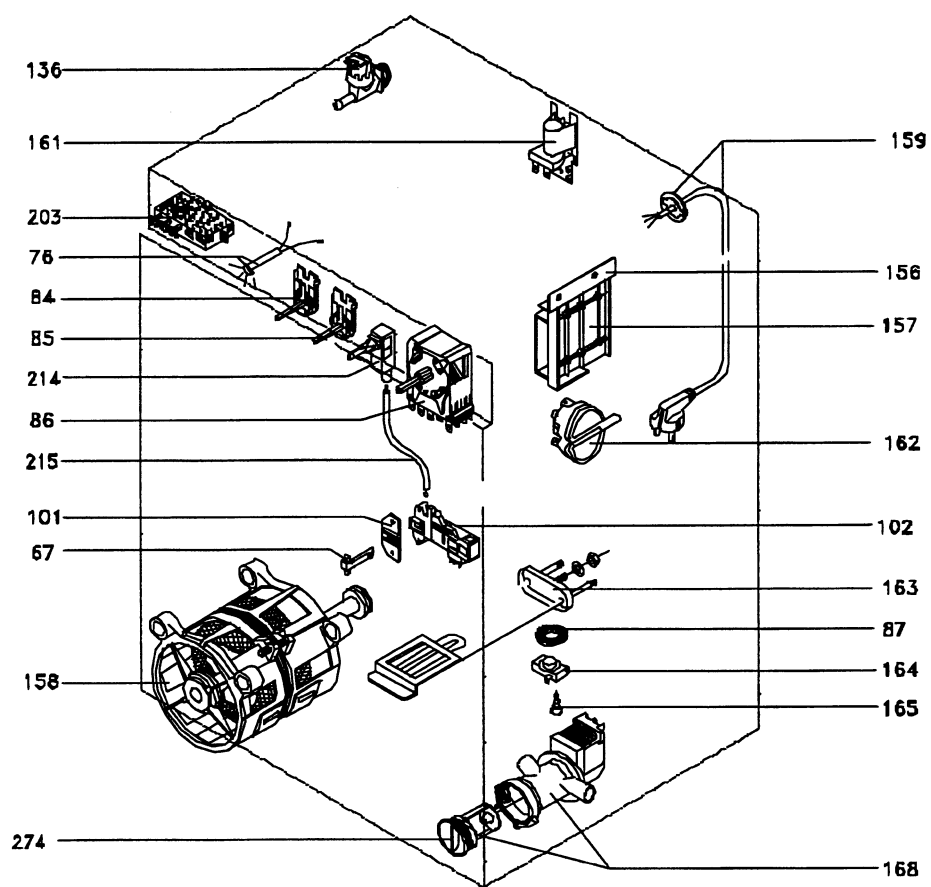

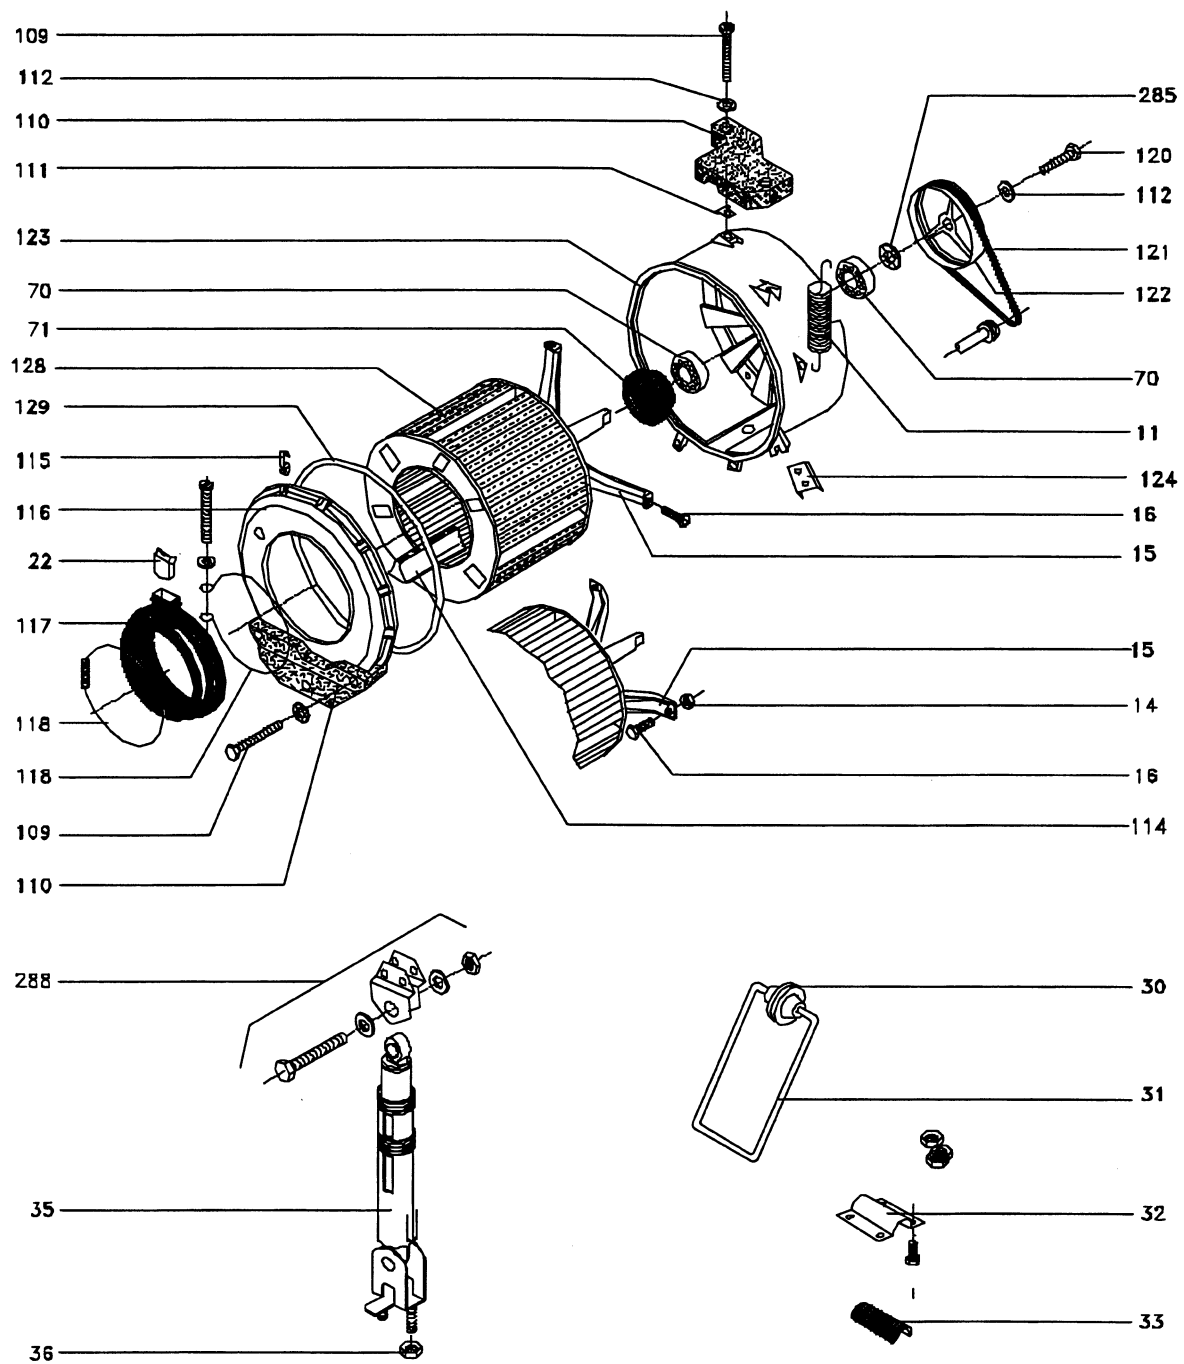

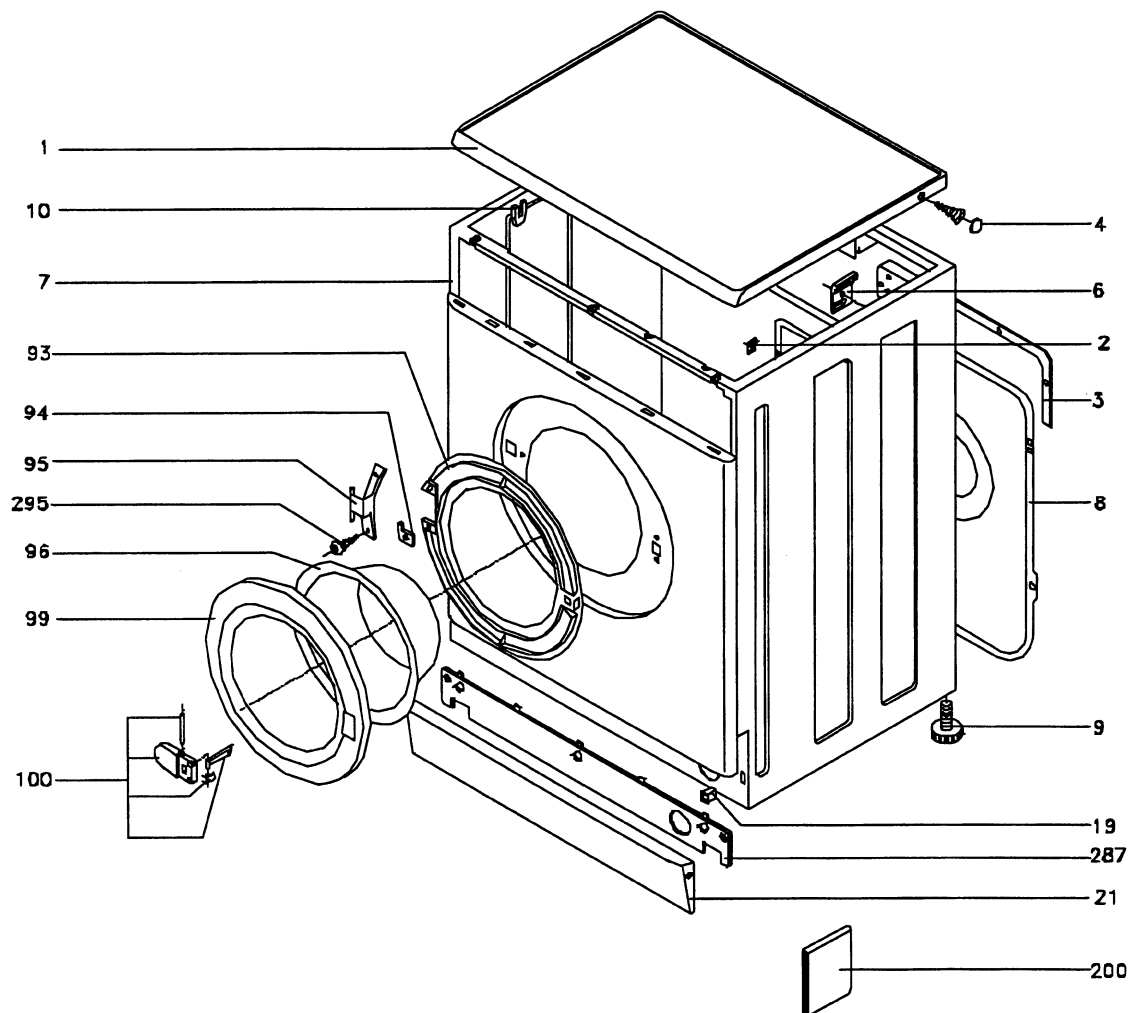

ESQUEMA TE RICO

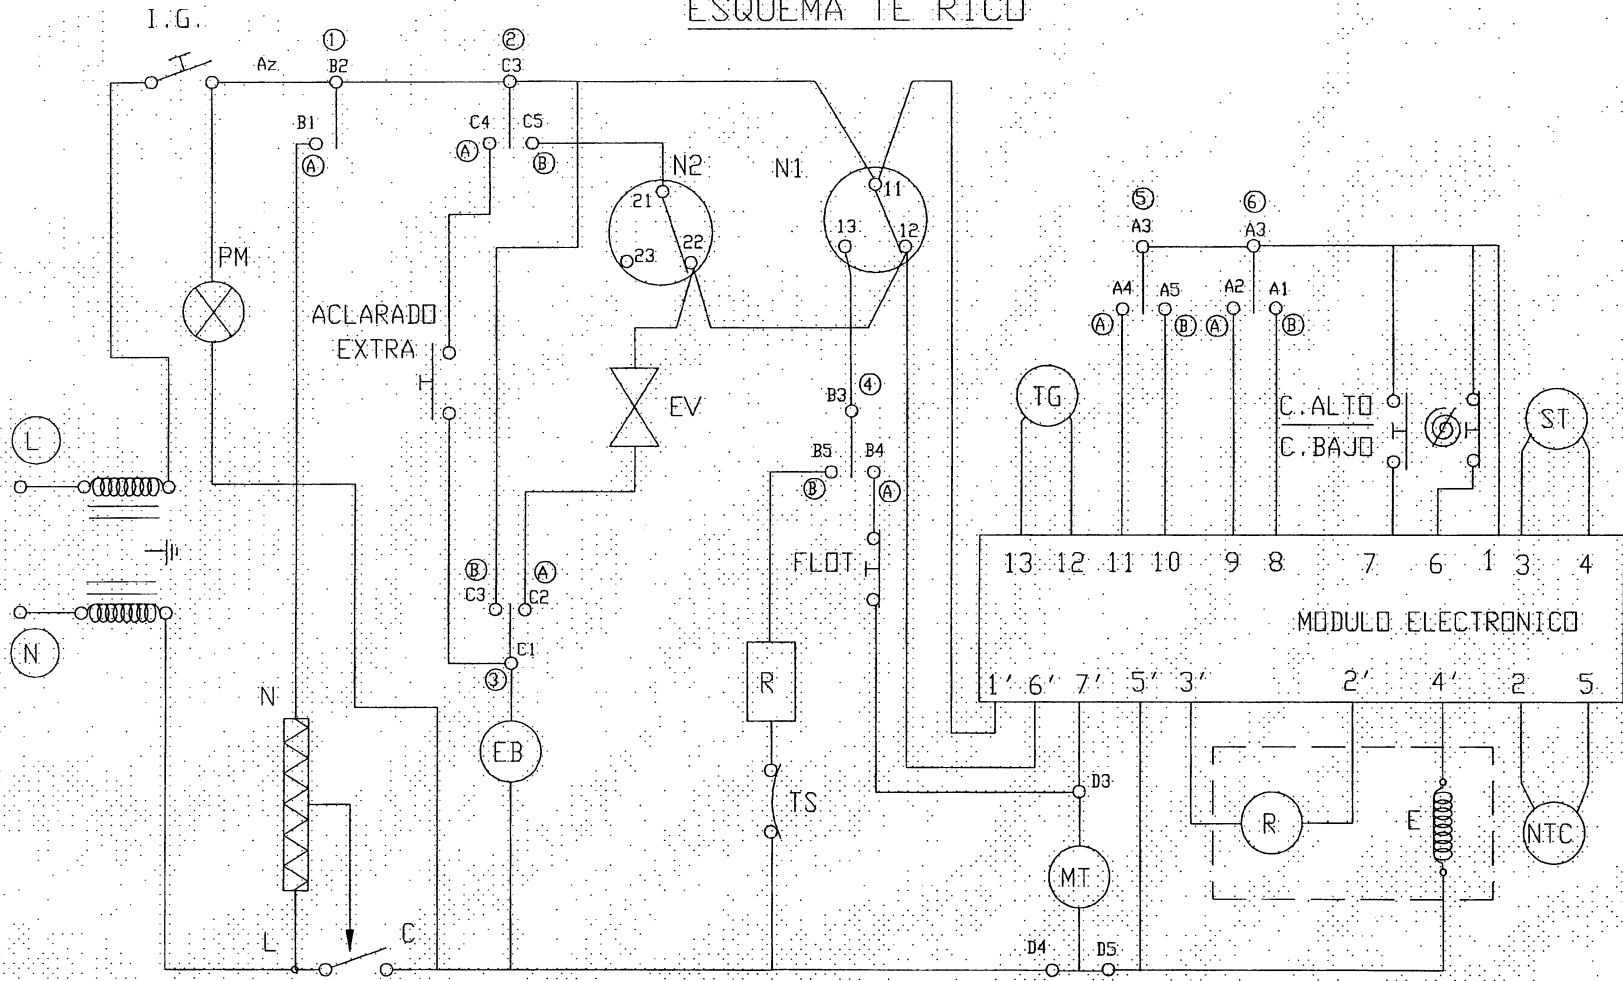


VALORES RESISTENCIA EN SELECTOR S/TEMPERATURA SELECCIONADA

SELECTOR DE TEMPERATURA	
Valor Resist.	C
10 K Ω	90
20 K Ω	80
30 K Ω	70
40 K Ω	60
50 K Ω	50
60 K Ω	40
70 K Ω	30
80 K Ω	FRIO

AGITACION CENTRIFUGADO

AGITACION	VACIADO+CENTRIFUGADO									
						LAVADORAS				
						650	850	1050	1250	
R.P.M.	OFF	ON	OFF	ON	OFF	ON				
1250	-	-	-	-	-	-	-	-	60	
1050	-	-	-	-	-	-	-	148	88	
850	-	-	-	-	-	-	148	-	-	
650	-	-	-	-	-	180	32	32	32	
400	-	-	-	-	-	30	30	30	30	
250	-	-	-	-	-	40	40	40	40	
140	-	-	-	-	-	34	34	34	34	
90	-	-	-	-	-	5	5	5	5	
42-90	-	-	-	-	-	8	8	8	8	
42	-	-	-	-	-	3	3	3	3	
35	-	6	-	6	-	-	-	-	-	
0	11	-	11	-	3	-	-	-	-	



SEGURIDAD

SEGURIDADES	CONDICION DE FALLO	ACTUACION LAVADORA	SITUACION FINAL
	Si en 8' no dispara el presostato nivel N1	El timer permanecerá alimentado, hasta encontrar una posición con el código A B	Llegará a la posición de STOP
FALLO DE VACIADO	Si a los 3'de empezar un vaciado no pierde el nivel de presostato	El timer se alimentará hasta la pos. de FLOT si la tecla está pulsada o hasta dos pos. antes del STOP	
CALENTA- ID	Si no se detecta un incremento de 5 C en 10' en todas las pos. de calentamiento.	Avanza la posición de calentamiento	Realiza el programa en frío (se detecta el fallo por que el lavado no a sido correcto)
MOTOR	Si estando alimentado el motor no se recibe se al de la taca	Al tercer intento se activará la se al de fallo	El programador se parará (sin alineación) en la posición donde se active el fallo

DIAGRAMA AGITACION LAVADO

AGITACION	MUY DELICADA		DELICADA		NORMAL												EXTRA	
	OFF	ON	OFF	ON	OFF	ON	OFF	ON	OFF	ON	OFF	ON	OFF	ON	OFF	ON	OFF	ON
300	-	-	-	-	-	3	-	-	-	-	-	-	-	-	-	-	-	-
90	-	-	-	-	-	6	-	-	-	-	-	-	-	-	-	-	-	-
55	-	-	-	7	-	7	-	7	-	7	-	7	-	7	-	7	-	-
35	-	6	-	6	-	6	-	6	-	6	-	6	-	6	-	6	-	20
0	11	-	6	-	5	-	5	-	5	-	5	-	5	-	5	-	1	-

DIAGRAMA CONTACTOS PROGRAMADOR

0: SIN SEÑAL (OFF)
1: HAY SEÑAL (ON)
X: INDIFERENTE (PUEDE ESTAR EN 1 O 2)

[illegible][illegible]

SPIN 99 COLD WATER

PROGRAMMES – N° 2 Wash N° 3 Rinses N° 4 Spin

PROGRAMMES – N° 2 Wash N° 3 Rinses N° 4 Spin

PROGRAMMER CONTACTS																	
CODE																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	
WATER INLET FROM PREWASH TO WASH																	
WATER INLET FROM WASH DRAWER																	
WATER INLET FROM BLEACH																	
WATER INLET FROM FABRIC SOFTENER																	
WATER INLET FROM PREWASH																	